

Reinspection Survey

FX0001132
Crosby Ravensworth CE School
Crosby Ravensworth
Penrith
Cumbria
CA10 3JJ



Inspectas Compliance Ltd
Head Office: Atlas House, 5 Bradford Road, Drighlington, BD11 1AS
Suite 19 Caxton Point, Caxton Way, Stevenage, Hertfordshire SG1 2XU
E info@inspectas.co.uk W inspectas.co.uk T 0844 264 0094

 **inspectas**
Compliance made easy

Contents:



Contents

1. Contract Review
2. Introduction / Purpose
3. Results
4. Recommendations

APPENDICES

Appendix 1 - Re-inspection Report

Appendix 2 - Product Register

Appendix 3 - Site Plans

1.0 Contract Review:



Name and address of site:	FX0001132, Crosby Ravensworth CE School, Crosby Ravensworth, Penrith, Cumbria		
Name and address of client:	Westmorland & Furness Council, South Lakeland House, Lowther Street, Kendal		
Client contact:	Andrew Hartley		
Type of survey:	Reinspection Survey (MA and PA) + Management options		
Date of survey:	9 Jan 2024		
Project Number:	J025428		
Lead surveyor[s]:	Stephen Stokell	Signature:	
Technically reviewed by:	Fiona Lindsay	Signature:	
Report issue date:	15 Jan 2024		
Previous Report Number: J18502 By: Inspectas Compliance Ltd Dated: 25th September 2022			

2.0 Introduction/Purpose:



Inspectas Compliance Ltd received an order of confirmation to undertake a Reinspection Survey from Westmorland & Furness Council. This order has been accepted on the basis of the original quotation and our terms and conditions of business.

The order relates to a Reinspection Survey of:

Site Address	Building Designation	Building Description	Age of building
FX0001132 Crosby Ravensworth CE School Crosby Ravensworth Penrith Cumbria	Crosby Ravensworth CE School	Commercial	1900's
General Building Construction Type *Individual room construction can be found within Appendix 3 of this report			
Brick built			

The Type of survey selected / requested by the client was a Reinspection Survey.

The purpose of the re-inspection was to examine and record the condition of asbestos containing materials located at the premises to enable compliance with Regulation 4.9 (a) of the Control of Asbestos Regulations 2012 (CAR 2012).

Regulation 4 of the CAR 2012 prescribes duties that must be complied with when managing the risk from asbestos in non-domestic premises.

Regulation 4. (9) CAR states that such measures should where necessary include:

- Monitoring of the condition of asbestos or suspect materials.
- Proper maintenance or removal of such materials.
- Provision of information about the location and condition of such materials is provided to every person liable to disturb it and the emergency services.

Regulation 4. (10) CAR states that measures must be taken to:

- Review and revise the management plan.
- Implement the measures specified in the plan.
- Record such implementation.

This re-inspection has been carried out to provide information to satisfy the requirement of Regulation 4.9 (a). to monitor and report the condition of asbestos containing materials.

Monitoring of the condition of identified asbestos containing materials is recommended at least every twelve months or at shorter intervals where the risk assessment on the location, condition or occupancy recommend more frequent monitoring under the management plan.

It is the client's responsibility to implement the requirements of Regulation 4, including updating the management plan using the information contained in this re inspection report, to complete the priority risk assessment based on their knowledge of the building occupancy, likelihood of disturbance, human exposure, and maintenance activities.

3.0 Results:



The findings of the re-inspection are detailed in Table 1 of this report, along with supporting data sheets for each ACM.

Asbestos containing items identified during the original survey or the latest re inspection have been examined and their current condition recorded and photographed.

Inspectas Compliance Ltd used the original survey data or the data from the last inspection for the Asbestos type and Product type in the Material assessment calculation.

For each ACM the material assessment has been calculated and reported and compared to the previous material assessment.

Where there has been a change in condition that could affect the management of the ACM, then the recommendation for managing the ACM may have been updated in accordance with the recommendations in HSG227.

Recommendations for the management of each ACM are reported and are in accordance with HSG227

If any additional suspected ACM's have been sampled, then these will have been reported as a Management Survey under a separate report. Any samples tested positive for asbestos will need to be added into the client's asbestos management plan, and included in the next re-inspection schedule.

It is stated that the priority assessment contained within this report falls outside of the scope of Inspectas Compliance's UKAS accreditation.

4.0 Recommendations:



To comply with and ensure that the requirements of section 2 & 3 of the Health and Safety at Work Act (as amended) 1974, the Management of Health and Safety at Work Regulations 1999, the Control of Asbestos Regulations 2012 and the Control of Substances Hazardous to Health 2002 are met. The following recommendations should be implemented:

Undertake suitable and sufficient Risk Assessments of asbestos containing materials against normal occupation and maintenance operations, in compliance with Regulations 3 of the Management of Health & Safety at Work Regulations 1999 and Regulation 6 of the Control of Asbestos Regulations 2012.

The findings of the re-inspection report be brought to the attention of those persons who are likely to come in contact with asbestos, in compliance with Section 2 and 3 of the Health and Safety at Work Act (as amended) 1974 and Regulation 9 of the Control of Asbestos Regulations 2012.

The findings of this re-inspection report are used to update the Asbestos Management Policy and to review this policy for implementation against planned arrangements in compliance with Regulation 4 of the Control of Asbestos Regulations 2012.

Specific recommendations in respect to the location and condition of asbestos materials recorded during the course of this re- inspection are recorded in the Data Sheets and Re-inspection Report Register. In considering the management of asbestos materials identified to date, these recommendations should be referred to and complied with.

It is recommended that further intrusive investigations and sampling be carried out where any refurbishment, maintenance, or similar activity may penetrate the fabric of the building. This should be a refurbishment or demolition survey as documented by HSG 264.

Table 1 – Re-Inspection Report:



Building	Floor	Room	Item / Material	Condition	Status since last inspection	This Inspection Priority Score	Surveyor Comments	Recommendations
Crosby Ravensworth CE School	Roof Void	Boys Toilet Ceiling Void. – AG018b	Cement water tank within ceiling void	Low Damage	Encapsulated	3	N/A	Manage and re-inspect
Crosby Ravensworth CE School	Ground	Boiler House – AG016	Presumed woven materials within Sime boiler units - not accessed to sample as live.	Good Condition	No Change	4	N/A	Inspection required
Crosby Ravensworth CE School	Ground	Boiler House – AG016	Bitumen wrap to electrical cable - unable to sample for health and safety reasons	Low Damage	No Change	5	N/A	Inspection required
Crosby Ravensworth CE School	Ground	Boiler House – AG016	Presumed woven within live electric box - unable to sample for health and safety reasons	Good Condition	No Change	4	N/A	Inspection required

Building	Floor	Room	Item / Material	Condition	Status since last inspection	This Inspection Priority Score	Surveyor Comments	Recommendations
Crosby Ravensworth CE School	Ground	Boiler House – AG016	Cement panels to beams and wall	Good Condition	No Change	4	N/A	Manage and re-inspect
Crosby Ravensworth CE School	Ground	Boiler House – AG016	Insulating board panels fixed to ceiling	Low Damage	No Change	4	N/A	Manage and re-inspect
Crosby Ravensworth CE School	Ground	Oil Store – AG015	Cement panels to ceiling beams and wall	Good Condition	No Change	4	N/A	Manage and re-inspect
Crosby Ravensworth CE School	Ground	Non Teaching Store – AG014	Cement panels to ceiling beams and wall	Good Condition	No Change	5	N/A	Manage and re-inspect

Asbestos Products Register:



	Re-inspection Date:	Lead Surveyor	Survey Type	Floor	Analysis
	9 Jan 2024	Stephen Stokell	Reinspection Survey	Ground Floor	Chrysotile (1)
	Building	Room	Item	Quantity	
	Crosby Ravensworth CE School	Non Teaching Store - AG014	Cement panels to ceiling beams and wall	4m ²	
	Sample No (S,SP,P,As)	Product Type	Surface Treatment	Condition	Accessibility
	As LM000490	Asbestos Cement (1)	Surface Sealed (1)	Good Condition (0)	Usually inaccessible or unlikely to be disturbed (0)

Normal Occupancy	Score	Likelihood of disturbance	Score	Exposure Potential	Score	Maintenance Activity	Score
Main type of activity	2	Location	2	Number of occupants	1	Type of Maintenance	0
		Accessibility	0	Frequency of use	0	Frequency of maintenance	1
		Amount	1	Average Time	0		
Average Score	2	Average Score	1	Average Score	1	Average Score	1
Average of Priority	5						
Material Assessment Score	3						
Combined Score:	8						
Recommendation	Manage and re-inspect						
Surveyor Comments	N/A						

KEY:

S – Sampled, P – Presumed, SP – Strongly Presumed, AS – Cross reference to former sample

Asbestos Products (cont)

	Re-inspection Date:	Lead Surveyor	Survey Type	Floor	Analysis
	9 Jan 2024	Stephen Stokell	Reinspection Survey	Ground Floor	Chrysotile (1)
	Building	Room	Item	Quantity	
	Crosby Ravensworth CE School	Oil Store - AG015	Cement panels to ceiling beams and wall	6m²	
	Sample No (S,SP,P,As)	Product Type	Surface Treatment	Condition	Accessibility
	As LM000490	Asbestos Cement (1)	Surface Sealed (1)	Good Condition (0)	Usually inaccessible or unlikely to be disturbed (0)

Normal Occupancy	Score	Likelihood of disturbance	Score	Exposure Potential	Score	Maintenance Activity	Score
Main type of activity	1	Location	2	Number of occupants	1	Type of Maintenance	0
		Accessibility	0	Frequency of use	1	Frequency of maintenance	2
		Amount	1	Average Time	0		
Average Score	1	Average Score	1	Average Score	1	Average Score	1
Average of Priority	4						
Material Assessment Score	3						
Combined Score:	7						
Recommendation	Manage and re-inspect						
Surveyor Comments	N/A						

KEY:

S – Sampled, P – Presumed, SP – Strongly Presumed, AS – Cross reference to former sample

Asbestos Products (cont)

	Re-inspection Date:	Lead Surveyor	Survey Type	Floor	Analysis
	9 Jan 2024	Stephen Stokell	Reinspection Survey	Ground Floor	Chrysotile (1)
	Building	Room	Item	Quantity	
	Crosby Ravensworth CE School	Boiler House - AG016	Presumed woven materials within Sime boiler units - not accessed to sample as live.	2no.	
	Sample No (S,SP,P,As)	Product Type	Surface Treatment	Condition	Accessibility
	P	Asbestos Textiles/Paper (2)	Unsealed (2)	Good Condition (0)	Usually inaccessible or unlikely to be disturbed (0)

Normal Occupancy	Score	Likelihood of disturbance	Score	Exposure Potential	Score	Maintenance Activity	Score
Main type of activity	1	Location	2	Number of occupants	1	Type of Maintenance	0
		Accessibility	0	Frequency of use	1	Frequency of maintenance	2
		Amount	0	Average Time	0		
Average Score	1	Average Score	1	Average Score	1	Average Score	1
Average of Priority	4						
Material Assessment Score	5						
Combined Score:	9						
Recommendation	Inspection required						
Surveyor Comments	N/A						

KEY:

S – Sampled, P – Presumed, SP – Strongly Presumed, AS – Cross reference to former sample

Asbestos Products (cont)

	Re-inspection Date:	Lead Surveyor	Survey Type	Floor	Analysis
	9 Jan 2024	Stephen Stokell	Reinspection Survey	Ground Floor	Chrysotile (1)
	Building	Room	Item	Quantity	
	Crosby Ravensworth CE School	Boiler House - AG016	Bitumen wrap to electrical cable - unable to sample for health and safety reasons	1lm	
	Sample No (S,SP,P,As)	Product Type	Surface Treatment	Condition	Accessibility
	P	Reinforced Composite (1)	Completely Sealed (0)	Low Damage (1)	Easily disturbed (2)

Normal Occupancy	Score	Likelihood of disturbance	Score	Exposure Potential	Score	Maintenance Activity	Score
Main type of activity	1	Location	2	Number of occupants	1	Type of Maintenance	0
		Accessibility	2	Frequency of use	1	Frequency of maintenance	2
		Amount	1	Average Time	0		
Average Score	1	Average Score	2	Average Score	1	Average Score	1
Average of Priority	5						
Material Assessment Score	3						
Combined Score:	8						
Recommendation	Inspection required						
Surveyor Comments	N/A						

KEY:

S – Sampled, P – Presumed, SP – Strongly Presumed, AS – Cross reference to former sample

Asbestos Products (cont)



Re-inspection Date:	Lead Surveyor	Survey Type	Floor	Analysis
9 Jan 2024	Stephen Stokell	Reinspection Survey	Ground Floor	Chrysotile (1)
Building	Room	Item	Quantity	
Crosby Ravensworth CE School	Boiler House - AG016	Presumed woven within live electric box - unable to sample for health and safety reasons	1no.	
Sample No (S,SP,P,As)	Product Type	Surface Treatment	Condition	Accessibility
P	Asbestos Textiles/Paper (2)	Unsealed (2)	Good Condition (0)	Usually inaccessible or unlikely to be disturbed (0)

Normal Occupancy	Score	Likelihood of disturbance	Score	Exposure Potential	Score	Maintenance Activity	Score
Main type of activity	1	Location	2	Number of occupants	1	Type of Maintenance	0
		Accessibility	0	Frequency of use	1	Frequency of maintenance	2
		Amount	0	Average Time	0		
Average Score	1	Average Score	1	Average Score	1	Average Score	1
Average of Priority	4						
Material Assessment Score	5						
Combined Score:	9						
Recommendation	Inspection required						
Surveyor Comments	N/A						

KEY:

S – Sampled, P – Presumed, SP – Strongly Presumed, AS – Cross reference to former sample

Asbestos Products (cont)

	Re-inspection Date:	Lead Surveyor	Survey Type	Floor	Analysis
	9 Jan 2024	Stephen Stokell	Reinspection Survey	Ground Floor	Chrysotile (1)
	Building	Room	Item	Quantity	
	Crosby Ravensworth CE School	Boiler House - AG016	Cement panels to beams and wall	6m²	
	Sample No (S,SP,P,As)	Product Type	Surface Treatment	Condition	Accessibility
	S LM000490	Asbestos Cement (1)	Surface Sealed (1)	Good Condition (0)	Usually inaccessible or unlikely to be disturbed (0)

Normal Occupancy	Score	Likelihood of disturbance	Score	Exposure Potential	Score	Maintenance Activity	Score
Main type of activity	1	Location	2	Number of occupants	1	Type of Maintenance	0
		Accessibility	0	Frequency of use	1	Frequency of maintenance	2
		Amount	1	Average Time	0		
Average Score	1	Average Score	1	Average Score	1	Average Score	1
Average of Priority	4						
Material Assessment Score	3						
Combined Score:	7						
Recommendation	Manage and re-inspect						
Surveyor Comments	N/A						

KEY:

S – Sampled, P – Presumed, SP – Strongly Presumed, AS – Cross reference to former sample

Asbestos Products (cont)

	Re-inspection Date:	Lead Surveyor	Survey Type	Floor	Analysis
	9 Jan 2024	Stephen Stokell	Reinspection Survey	Ground Floor	Chrysotile + Amosite (2)
	Building	Room	Item	Quantity	
	Crosby Ravensworth CE School	Boiler House - AG016	Insulating board panels fixed to ceiling	6m ²	
	Sample No (S,SP,P,As)	Product Type	Surface Treatment	Condition	Accessibility
	S LM000491	Asbestos Insulating Board (2)	Surface Sealed (1)	Low Damage (1)	Usually inaccessible or unlikely to be disturbed (0)

Normal Occupancy	Score	Likelihood of disturbance	Score	Exposure Potential	Score	Maintenance Activity	Score
Main type of activity	1	Location	2	Number of occupants	1	Type of Maintenance	0
		Accessibility	0	Frequency of use	1	Frequency of maintenance	2
		Amount	1	Average Time	0		
Average Score	1	Average Score	1	Average Score	1	Average Score	1
Average of Priority	4						
Material Assessment Score	6						
Combined Score:	10						
Recommendation	Manage and re-inspect						
Surveyor Comments	N/A						

KEY:

S – Sampled, P – Presumed, SP – Strongly Presumed, AS – Cross reference to former sample

Asbestos Products (cont)

	Re-inspection Date:	Lead Surveyor	Survey Type	Floor	Analysis
	9 Jan 2024	Stephen Stokell	Reinspection Survey	Roof Void	Chrysotile (1)
	Building	Room	Item	Quantity	
	Crosby Ravensworth CE School	Boys Toilet Ceiling Void. - AG018b	Cement water tank within ceiling void	1no.	
	Sample No (S,SP,P,As)	Product Type	Surface Treatment	Condition	Accessibility
	S LM000487	Asbestos Cement (1)	Surface Sealed (1)	Low Damage (1)	Usually inaccessible or unlikely to be disturbed (0)


Normal Occupancy	Score	Likelihood of disturbance	Score	Exposure Potential	Score	Maintenance Activity	Score
Main type of activity	0	Location	1	Number of occupants	1	Type of Maintenance	0
		Accessibility	0	Frequency of use	0	Frequency of maintenance	1
		Amount	1	Average Time	0		
Average Score	0	Average Score	1	Average Score	1	Average Score	1
Average of Priority	3						
Material Assessment Score	3						
Combined Score:	6						
Recommendation	Manage and re-inspect						
Surveyor Comments	N/A						

KEY:

S – Sampled, P – Presumed, SP – Strongly Presumed, AS – Cross reference to former sample

Plans



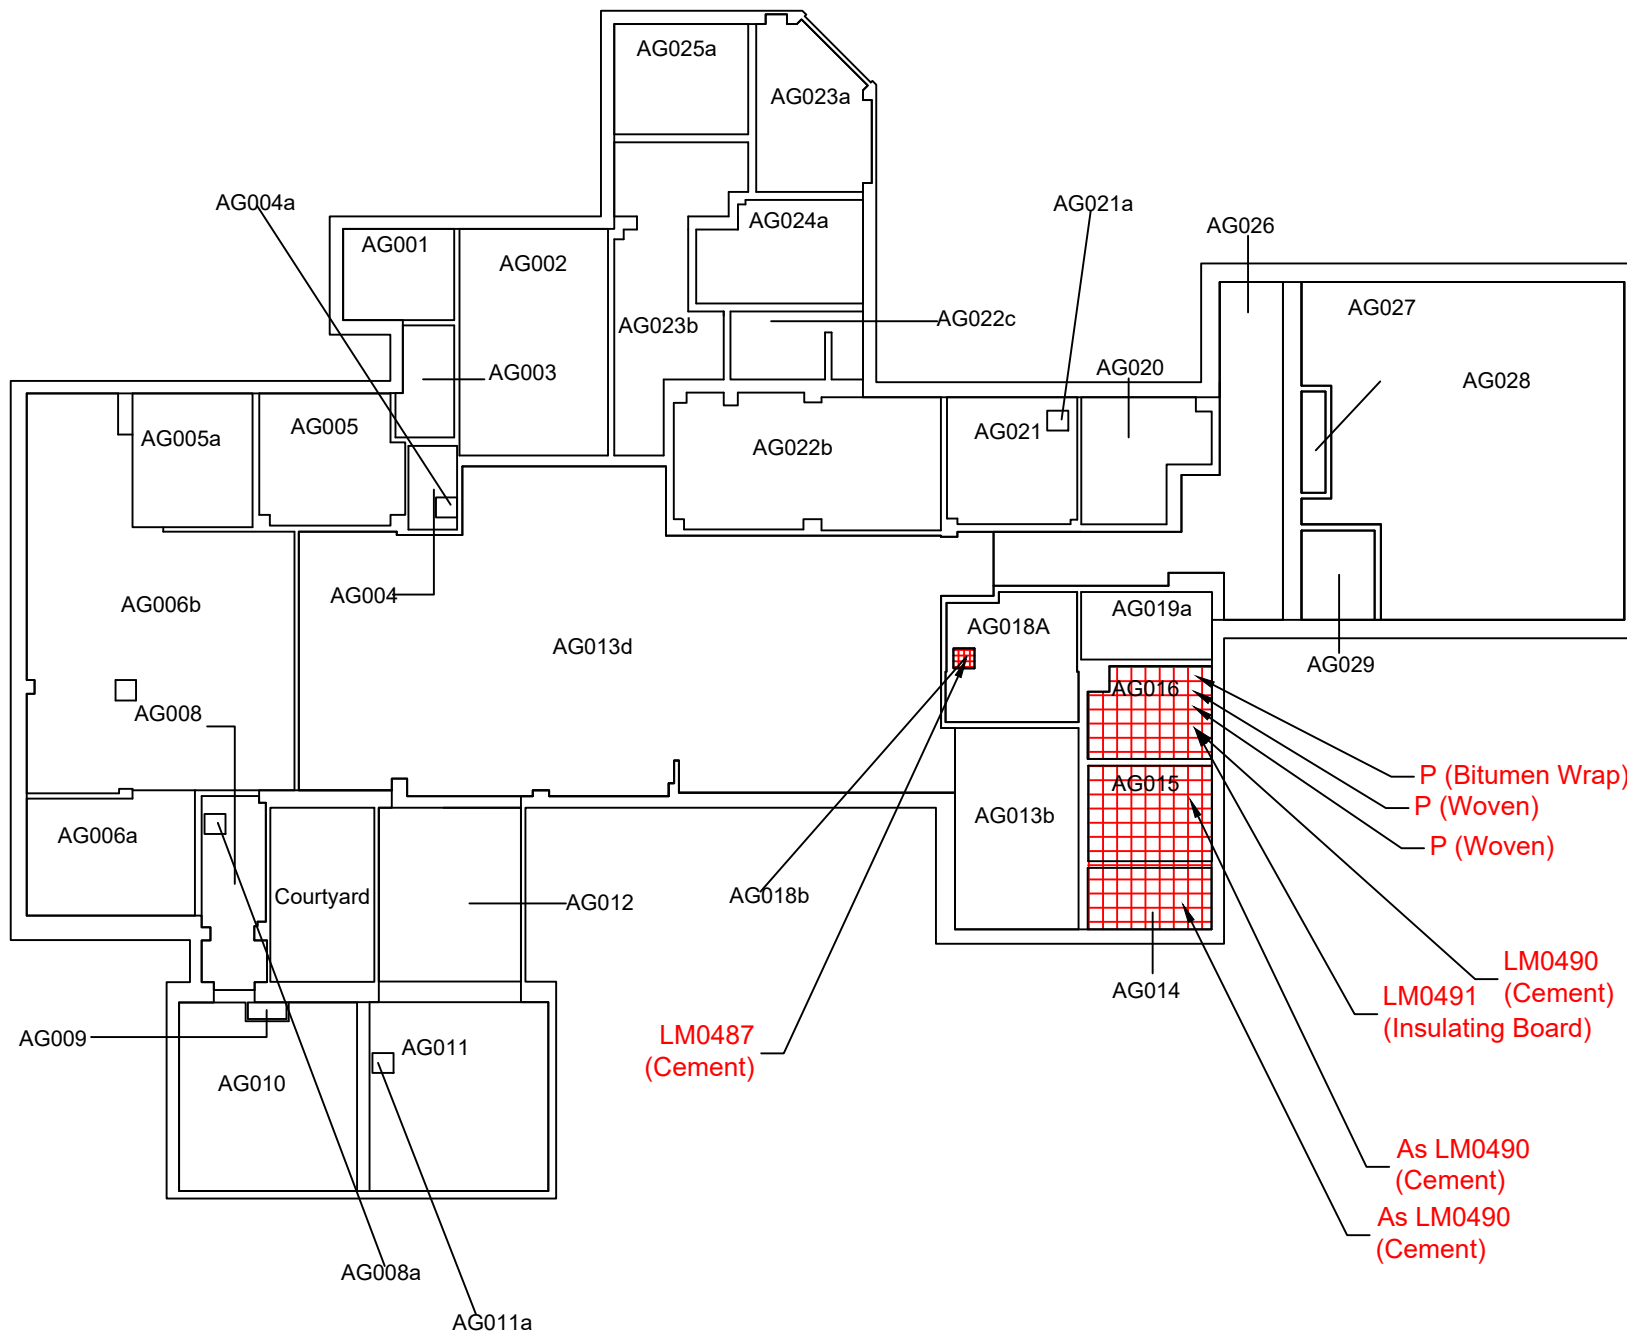

KEY

AC001 POSITIVE SAMPLES

AC001 NEGATIVE SAMPLES

AREAS OF NO ACCESS

ACM PRESENTS

OUTSIDE SCOPE OF WORK

G/01 ROOM NUMBERS

PLAN NOT TO SCALE

JOB REFERENCE: J25428

FX0001132,
Crosby Ravensworth CE School,
Crosby Ravensworth,
Penrith,
Cumbria,
CA10 3JJ

Floor: Ground Floor

AUTHOR: JU

inspectas
Compliance made easy

Asbestos Management Plan

FX0001132
Crosby Ravensworth CE School
Crosby Ravensworth
Penrith
Cumbria
CA10 3JJ



Inspectas Compliance Ltd
Suite 2, 5th Floor, North Wing, West World, London, W5 1DT
E info@inspectas.co.uk W inspectas.co.uk T 0844 264 0094

 **inspectas**
Compliance made easy

Contents

1. Introduction to the management plan
2. Asbestos Register and Action Plan
3. Site Plans
4. Contractor/Staff Management
5. Communication Process
6. Register Procedures and Responsibilities
7. Emergency Procedures
8. Contractor Requirements
9. Reviewing and updating the management plan
10. Designated responsible person(s)
11. Contractor Confirmation

1. Introduction to the Management Plan

Management Plan Purpose

- | An asbestos management plan is a regulatory requirement of the CAR 2012 and is prepared to show where asbestos is located within the building and provides information of how the risks posed from the identified asbestos will be managed.
- | The management plan is prepared using information based on the asbestos survey findings.
- | This asbestos management plan, including records and drawings, should be reviewed and revised at least every 12 months. The management plan must also be reviewed if there is reason to believe that circumstances have changed. The plan, records and drawings should then be updated accordingly.
- | The asbestos management plan is designed to ensure, as far as reasonably practical, the health, safety and welfare of all persons who may be affected by the above site.
- | This asbestos management plan must be read in its entirety to obtain all site information and procedures prior to works commencing.
- | In accordance with schedule of accreditation, Inspectas are not accredited under ISO17020/ISO17025 for providing opinions and interpretations on asbestos regulations and guidance contained within this management plan. UKAS currently do not offer accreditation for asbestos management plans.

2. Asbestos Register & Action Plan

Building	Floor	Location /Room / Item	S,P,SP,AS Sample No	Condition	Surface Treatment	Asbestos Type	Quantity	Accessibility	Total PA risk assessment score	Management Action	Additional Comments	Timescale
Crosby Ravensworth CE School	Ground	Non Teaching Store - AG014 - Cement panels to ceiling beams and wall	As LM000490	Good Condition	Surface Sealed	Chrysotile	4m ²	Usually inaccessible or unlikely to be disturbed	8	No attention required, review at stated interval	N/A	12 Months
Crosby Ravensworth CE School	Ground	Oil Store - AG015 - Cement panels to ceiling beams and wall	As LM000490	Good Condition	Surface Sealed	Chrysotile	6m ²	Usually inaccessible or unlikely to be disturbed	7	No attention required, review at stated interval	N/A	12 Months
Crosby Ravensworth CE School	Ground	Boiler House - AG016 - Bitumen wrap to electrical cable - unable to sample for health and safety reasons	P	Low Damage	Completely Sealed	Chrysotile	1lm	Easily disturbed	8	This material must be sampled prior to any disturbance to determine whether it is an ACM. In the meantime, as a precaution, this material should be labelled with an approved asbestos warning label.	N/A	As required
Crosby Ravensworth CE School	Ground	Boiler House - AG016 - Cement panels to beams and wall	S LM000490	Good Condition	Surface Sealed	Chrysotile	6m ²	Usually inaccessible or unlikely to be disturbed	7	No attention required, review at stated interval	N/A	12 Months

KEY:


S – Sampled, P – Presumed, SP – Strongly Presumed, AS – Cross reference to former sample

Building	Floor	Location /Room / Item	S,P,SP,AS Sample No	Condition	Surface Treatment	Asbestos Type	Quantity	Accessibility	Total PA risk assessment score	Management Action	Additional Comments	Timescale
Crosby Ravensworth CE School	Ground	Boiler House - AG016 - Insulating board panels fixed to ceiling	S LM000491	Low Damage	Surface Sealed	Chrysotile + Amosite	6m ²	Usually inaccessible or unlikely to be disturbed	10	No attention required, review at stated interval	N/A	12 Months
Crosby Ravensworth CE School	Ground	Boiler House - AG016 - Presumed woven materials within Sime boiler units - not accessed to sample as live.	P	Good Condition	Unsealed	Chrysotile	2no.	Usually inaccessible or unlikely to be disturbed	9	This area was inaccessible during the survey and may contain an ACM. If this area is to be accessed for any reason a full inspection must first be carried out	N/A	As required
Crosby Ravensworth CE School	Ground	Boiler House - AG016 - Presumed woven within live electric box - unable to sample for health and safety reasons	P	Good Condition	Unsealed	Chrysotile	1no.	Usually inaccessible or unlikely to be disturbed	9	This material must be sampled prior to any disturbance to determine whether it is an ACM. In the meantime, as a precaution, this material should be labelled with an approved asbestos warning label.	N/A	As required
Crosby Ravensworth CE School	Roof Void	Boys Toilet Ceiling Void. - AG018b - Cement water tank within ceiling void	S LM000487	Good Condition	Surface Sealed	Chrysotile	1no.	Usually inaccessible or unlikely to be disturbed	6	No attention required, review at stated interval	N/A	12 Months

KEY:

S – Sampled, P – Presumed, SP – Strongly Presumed, AS – Cross reference to former sample

3. Site Plans

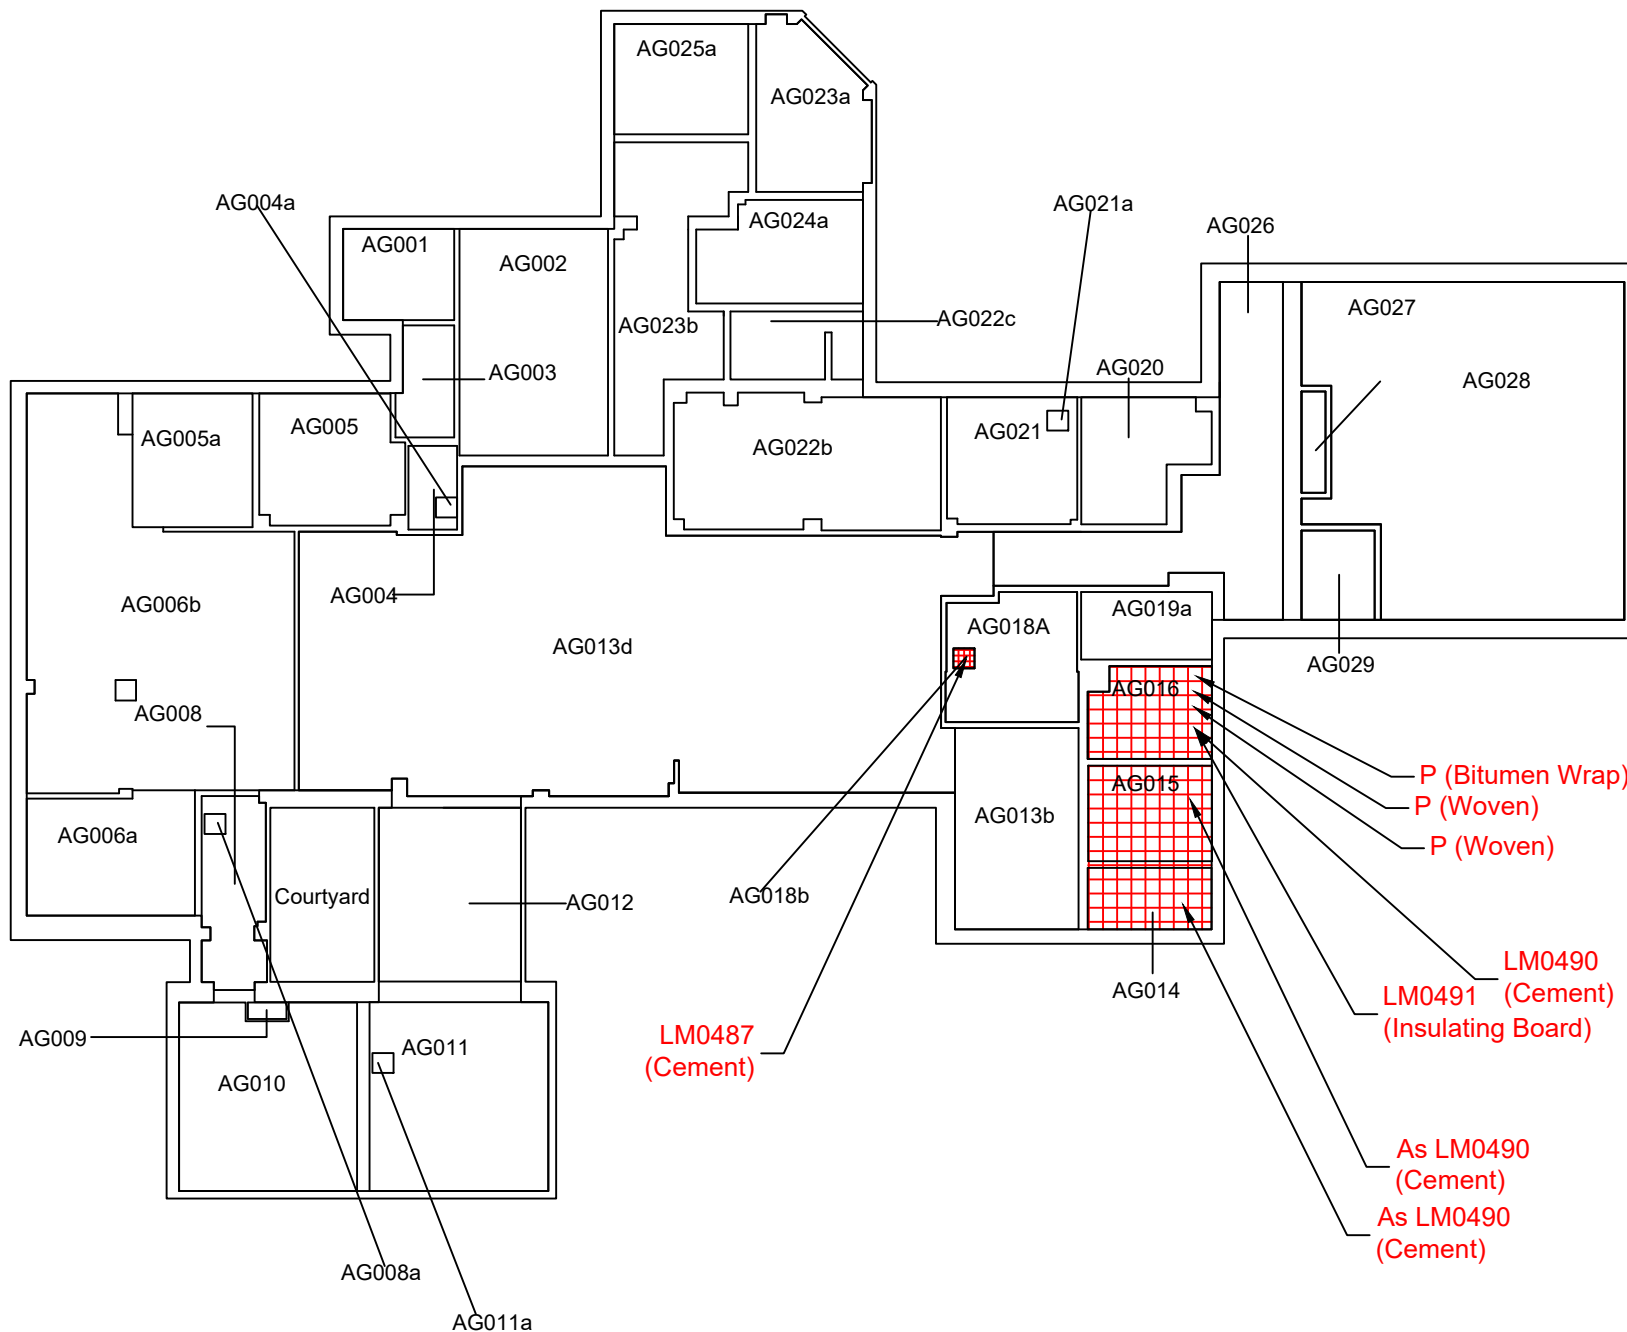

KEY

AC001 POSITIVE SAMPLES

AC001 NEGATIVE SAMPLES

AREAS OF NO ACCESS

ACM PRESENTS

OUTSIDE SCOPE OF WORK

G/01 ROOM NUMBERS

PLAN NOT TO SCALE

JOB REFERENCE: J25428

FX0001132,
Crosby Ravensworth CE School,
Crosby Ravensworth,
Penrith,
Cumbria,
CA10 3JJ


Floor: Ground Floor

AUTHOR: JU

inspectas
Compliance made easy

4. Contractor/Staff Management

The flow charts below apply to all persons undertaking works within the site

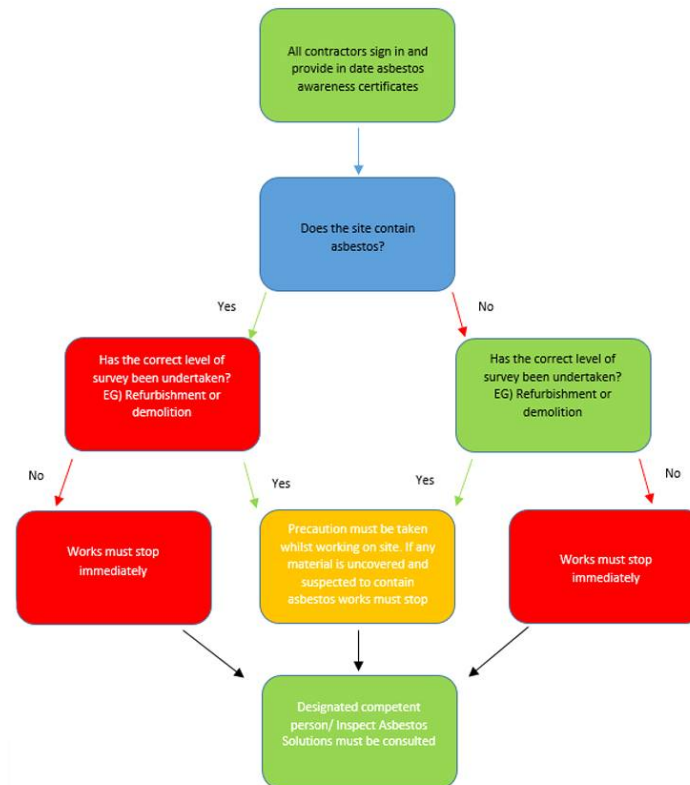

5. Communication Process

Staff & Visitors

- The **duty holder/assigned responsible person** is the responsible person on this site.
- They should make available and pass on the asbestos information through the relevant departments and make available to any visitors when required/requested.
- The responsible person on site can be found in section 10 of this management plan.

Contractors & Maintenance Staff

- All contractors are required to sign when they arrive on site.
- All contractors must have a copy of their RAMS on site with them at all times.
- Contractors must then read the asbestos register and confirm it has been understood.
- The management plan must also be made available to the emergency services.

Labelling

- The labelling of asbestos products is not a procedure that has been adopted for this site.
- Labels can fall off products, and are therefore not a reliable way of communicating where asbestos bearing materials are present.
- Instead, a thorough communication of the asbestos register and management plan procedures, which requires contractors/staff to read and sign they have understood, has been adopted.
- This also includes that contractors are asbestos awareness trained prior to beginning their works on site.

6. Register Procedures & Responsibilities

Register Procedures

The asbestos register, including drawings, will be available on site for the entire life of the premises and will be updated as required.

The asbestos register, including its location on site, will be shared with any co-worker/contractor carrying out maintenance or undertaking any other work on site by the duty holder/responsible person.

Responsibilities

The duty holder/assigned responsible person, should ensure that this management plan is implemented. If unsure on any aspect of the plan, specialist advice will be sought by competent persons employed by Inspectas Compliance Ltd.


The duty holder/responsible person, shall only allow works to begin when they are satisfied that the information in the asbestos register is known and understood by the workers. (See section 8)

The duty holder/responsible person, shall instruct staff/contractors that work on the fabric of the building cannot start without the relevant parts of the record/register being checked, and making sure that the correct survey level has been undertaken prior to works commencing.

7. Emergency Procedure

Although planned works can be managed, it is important to know what to do in the event that an asbestos bearing material is discovered or damaged

Below is a simple emergency procedure to follow:

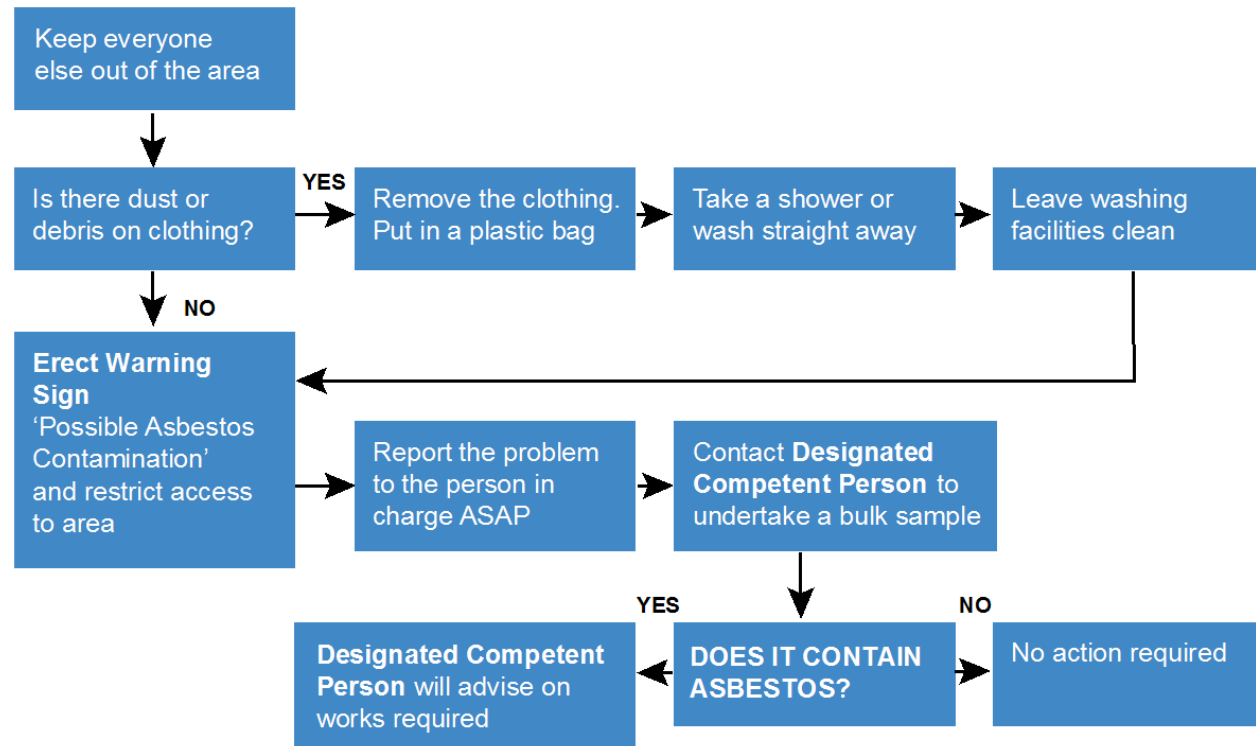

8. Contractor Requirements

All contractors must confirm their works will:

- Not disturb asbestos and/or any asbestos bearing materials.
- Not require a more intrusive survey to be undertaken ie. Refurbishment/Demolition

All contractors must:

- Demonstrate that they have undertaken Asbestos Awareness Training.
- Read the on-site asbestos register.
- Must sign that they have read and understood the Asbestos Register.
- During the course of work, if any material is found which may be suspected of containing asbestos, works must STOP IMMEDIATELY and contact be made with the site contact who can contact Inspectas on 0844 264 0094 or email info@inspectas.co.uk for assistance.
- Note: Where asbestos removal or remedial works are required on site, the duty holder/responsible person, shall liaise with Inspectas who can assist in appointing the correct contractor for the works required.

9. Review & Updating the Management

As a minimum, this management plan, including all records and drawings, will be reviewed every 12 months. It will also be reviewed if circumstances change eg. There is a change of use of building, works being undertaken, ACMs removed or repaired.

All known or suspected ACMs will be inspected and assessed periodically, to check that the product has not deteriorated or been damaged. The inspection of some products may be more frequent dependent on the location of the product and other factors that could affect their condition. Inspect Asbestos Solutions will assist where necessary.

In the event of changes eg. Maintenance work, new tenants or employees, the management plan should be reviewed accordingly.

Reviews of the effective implementation of the management plan will be assessed should there be an instance where there has been a failure in procedure

for example:

- where procedures have not been followed and why not;
- where procedures have been inadequate;
- and where exposure to asbestos has occurred.

Inspectas/a competent person will be consulted for all of the above contained within section 9.

10. Designated Responsible Person(s)

The following person(s) has been identified as responsible for ensuring the implementation of this management plan for this site:

The duty holder for this site is:

Name:

Position: **Duty Holder**

Contact No:

By signing this document I declare I have read and understood all aspects of this management plan and take responsibility for implementing all procedures throughout the site.

Other responsible persons for this site are:

Name:

Position:

Date:

Signature:

Name:

Position:

Date:

Signature:

Note: Inspectas strongly recommend that all responsible persons on site are of a minimum, Asbestos Awareness Trained. Inspectas must be consulted should any part of this management plan not be understood by the responsible person(s).

11. Contractor Confirmation.

I confirm I have read and understood the above information

Name:	Company:	Date:	Signature:

Name:	Company:	Date:	Signature:

